

# Manhole Inspection Summary

Manhole # S23K\_\_052MH

Printed On: 1/15/2009

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **23K** Node: **052** Status: **Found**

Insp Date: **6/11/08 11:40 AM**

Incomplete Comments

Crew: **wj,eh**  
Inspector: **wjenkins**  
Firm: **PER**

**Location** Address: **310 S Caulhoun St (behind in alley)** Cross Street: **S Norris St**

**Manhole** Type: **Junction** Location: **Alley** Ground Conditions: **Dry**  
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)  
**75**

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **2** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **5** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **34** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **2** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S23K\_\_052MH

Printed On: 1/15/2009

Page 2 of 5

Location View



Top View




Miscellaneous



Cover View



Location View

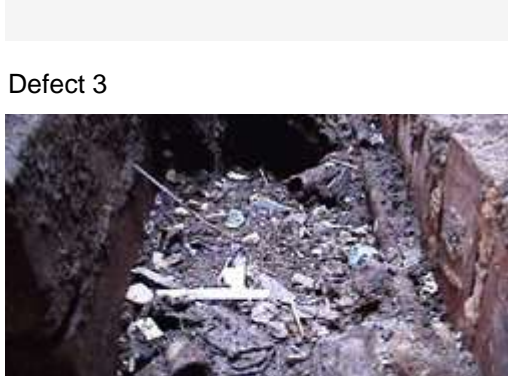

Defect 3



Debris in channel

Defect 2



debris on bench

Defect 1



frame-lid infiltration

Defect 4



2" offset

## Manhole Inspection Summary

Manhole # S23K\_\_052MH

Printed On: 1/15/2009

Page 4 of 5

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **5.27** (ft.) Flow Characteristics: **None**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 4 O'Clock

4 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **5.08** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S23K\_\_052MH

Printed On: 1/15/2009

Page 5 of 5

4 in. Circular Gravity Sewer  
Pipe In @ 8 O'Clock

8 O'Clock Inflow



Pipe Height: **4.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **4.75** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection